



The **DCS5-070718** piezoelectric stack consists of multiple chips which are bonded via epoxy. It offers a maximum displacement of 19.0  $\mu$ m. The red wire of the electrode serves as the positive terminal (+), and the black wire is the negative terminal (-).



### DCS5-070718

Drive Voltage Range	-30~120 V	Capacitance	$3.7\mu\text{F}\pm15\%$
Displacement (Free Stroke) at 150 V	$19.0~\mu m \pm 15\%$	Dissipation Factor	<2.3%
Hysteresis	<15%	<b>Resonant Frequency</b>	70kHZ
Stiffness	98 N/µm	Blocking Force at 150 V	1960N
Curie Temperature	230 °C	Operating Temperature	-25 ~ 130 °C
Product Size	L: 7.0mm	Outer Dimensions	L: 7.2 ± 0.2mm
	W: 7.0mm		$W:9.2\pm0.2mm$
	H: 18.0mm		H: $18.0 \pm 0.05$ mm

### **Performance Parameters**

• All specifications are quoted at 25°C, unless otherwise stated.


• The displacement may vary slightly for different loads, and the maximum displacement

occurs when used with the recommended load.

Guangdong DCpiezo Technology Co., Ltd.





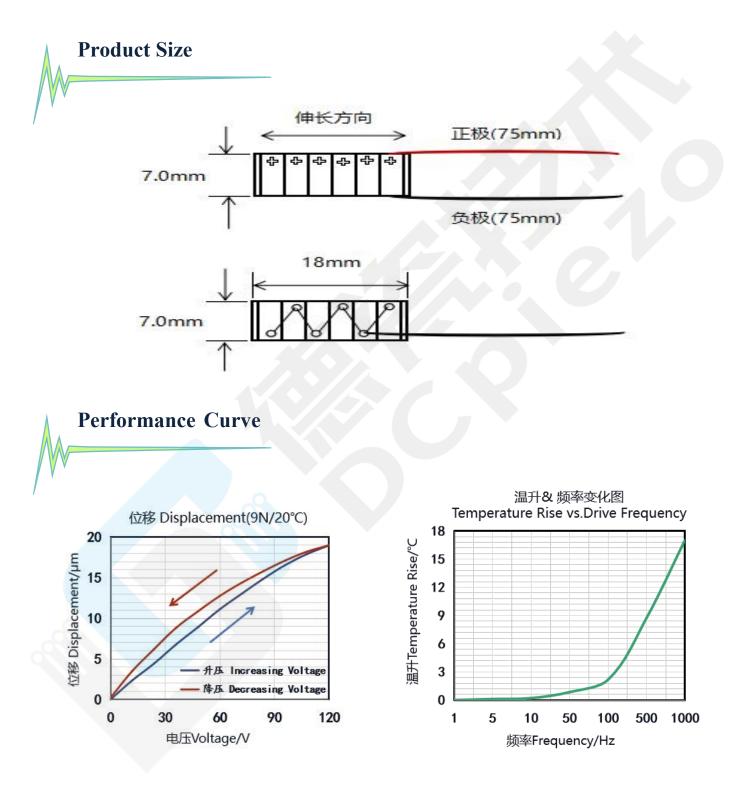

• These temperature rises were measured after applying a sine-wave drive voltage ranging from 0 to 120V at the specified frequency for 10 minutes.

Guangdong DCpiezo Technology Co., Ltd.

http://www.dc-piezo.com Tel:+86 13798552005 WeChat:13798552005 Email:dcpiezo@163.com





### **Matters Needing Attention**

#### 1. Storage Conditions & Precautions:

Temperature: <50 °C, Humidity: <40%Rh. Avoid impact and compression. Store in vacuum-sealed bags for long-term preservation. When not in use, connect to a resistive discharge ( $\geq$ 100k $\Omega$ ) or short-circuit (for low-capacitance ceramics).

#### 2. Operating Conditions & Precautions:

Temperature: Maximum operating temperature  $\leq 130^{\circ}$ C (preferably  $< 60^{\circ}$ C). Add heat dissipation measures if temperature exceeds  $80^{\circ}$ C.

Humidity: <50%Rh. In high-humidity environments, preheat at low voltage before use to avoid creepage discharge.

Dust Avoidance: Dust adhesion on ceramic surfaces may reduce insulation resistance.

Clearance: Maintain a gap >1.6mm between ceramics and other conductors.

Safety: Do not immerse piezoelectric stacks in organic solvents or expose to flammable gases/liquids.

#### 3. Assembly Precautions:

Polarity: Red wire = positive (+), black wire = negative (-). Reverse polarity may cause mechanical failure.

Handling: Handle with care to avoid impact. Wear gloves to prevent oil contamination.

Fit Tolerance: Assemble with clearance fit first, then tighten. Avoid interference fit to prevent ceramic compression.

Electrostatic Protection: Maintain >1.6mm gap between ceramics and metal parts to avoid static discharge.

Adhesive Bonding: Ensure flat bonding surfaces and remove excess glue to minimize contamination. Soldering: Limit contact time under high temperature to <1 second to protect ceramics and coatings.

High-Temperature Assembly: Control temperature <120  $^{\circ}$ C to prevent depolarization, adhesive failure, or coating damage.

#### 4. Preload Instructions:

Load Application: Apply external load to the center of the stack or distribute uniformly on the Guangdong DCpiezo Technology Co., Ltd.

http://www.dc-piezo.com Tel:+86 13798552005 WeChat:13798552005 Email:dcpiezo@163.com






mounting surface. Ensure contact surfaces are flat and smooth.

Force Direction: Piezoelectric stacks can only withstand axial forces. Shear or torsional forces may cause mechanical failure.

Preload Force: Preload should not exceed 40% of maximum blocking force, and its direction must align with the motion axis to minimize shear stress.

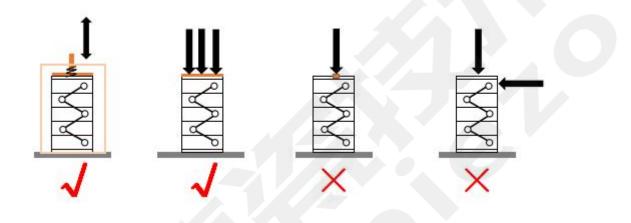

Guangdong DCpiezo Technology Co., Ltd.